



13. G. 88

FELLESTRAADET FOR DET SOERLIGE  
c/o NORWEGIAN PEOPLE'S AID  
P.O. BOX 3381  
DAR ES SALAAM

Main Office:  
Bygdøy Allé 5  
0257 Oslo 2, Norway  
Tel.: (02) 56 56 90/5  
International call: +47 2 56 56 90/5  
Telex: 19361 Nplan N

NPA-DSM.  
J. No: 520  
DATE 15/06/88

ATT: MR.K.MEKKI

Your ref.:

Our ref.: T024/NT205/88/CWG/jm ~~888~~ DSM.1988.06.13

RE : SUPERVISION OF ANC HOUSE AT KURASINI PLOT 28

Report on site visits 6/6/88 and 10/6/88.

6/6/88

- ✓ 1. Old building no.2 brandering for false ceiling ready in three rooms. Trusses repaired and battens for roof tiles ready fixed.
- ✓ 2. Weld mesh fabric for new building floor slab now on site.
- 3. Few workers on site but no work seems to be in progress.
- 4. Neither Mr.Kimambo nor foreman on site to get any information.

10/6/88

Present: Mr.Kimambo & Mr.Gomes

- ✓ 1. Slab for new building cast completely sometime during the week, curing being carried out.
- ✓ 2. Roofing tiles for Building 2 not yet available according to Mr.Kimambo as there is some problem with availability of raw materials. Perhaps by early next month. In the meantime works for roofing continue eg. Eaves board.
- ✓ 3. Door & Window frames from Mazimbu have no horns at the top and door frames are not long enough to fix in the floor.

Comments

OK a) Our office was not informed of the casting date of the floor slab, therefore the undersigned was not present to inspect the operation. The only comments we therefore make are:-

- 1. The surface seems very rough and brown
- 2. No cubes seem to have been taken for testing.

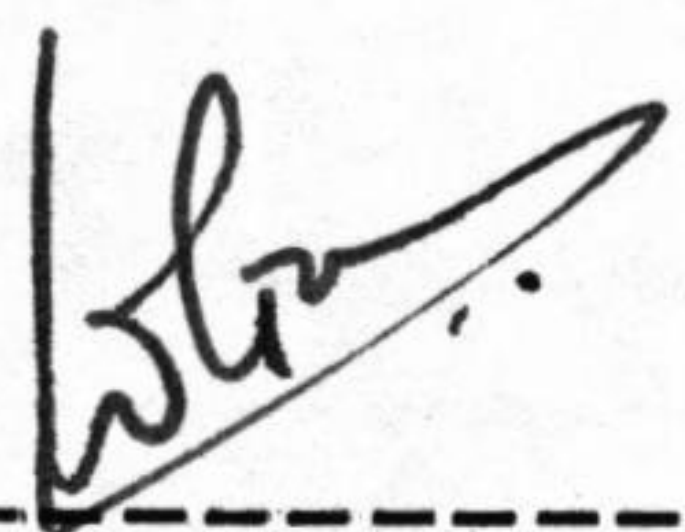
b) Construction of outer walls can begin immediately while inner walls should be taken up 7 day after the last pour.

Cont'd ..2/..



- c) A decision must be made on the roofing tiles for old building no.2, as extended exposure of the roofing timbers to the elements may cause warping of the timbers.
- d) It is suggested in the case of the door frames from Mazimbu that 4" Nails be hammered in to the lower end of the frames and the nails at least be embedded in the floor. Since the door frames have already been rebated a sketch should be issued to the contractor indicating side and direction of Door shulter movement, to avoid confusions that may arise.

Yours faithfully,  
for NORPLAN A/S(T)BRANCH

  
-----  
C.W. GOMES  
PROJECT ENGINEER

**NORPLAN**  
**TANZANIA BRANCH**  
P.O. BOX 2820  
DAR ES SALAAM  
TANZANIA

c.c Mr. K. Ekeberg , Oslo.